

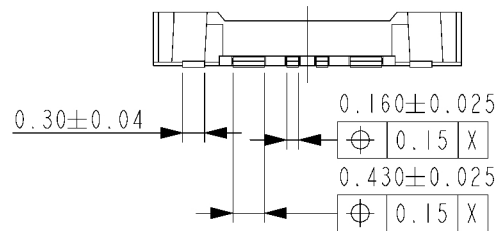
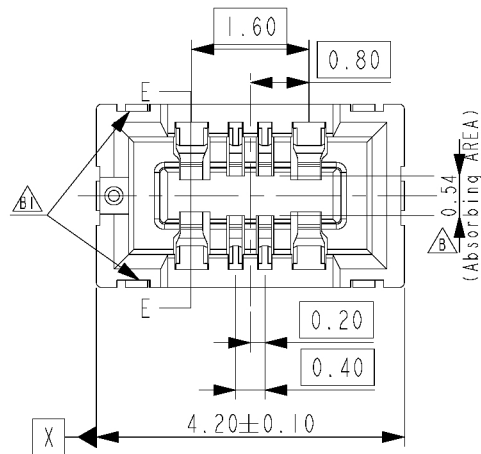



REV.	ECN NUMBER	DESCRIPTION	DATE	DRAWN	CHECKD	APPROVED
A	PDR15323	NEW RELEASE	10/21/15'	SEAN	SEAN	SEAN
B	ECN161216	A X02 MX02	06/30/16'	ADDY		SEAN
C	ECN161915	A X01 MX01	02/20/17'	ADDY		SEAN

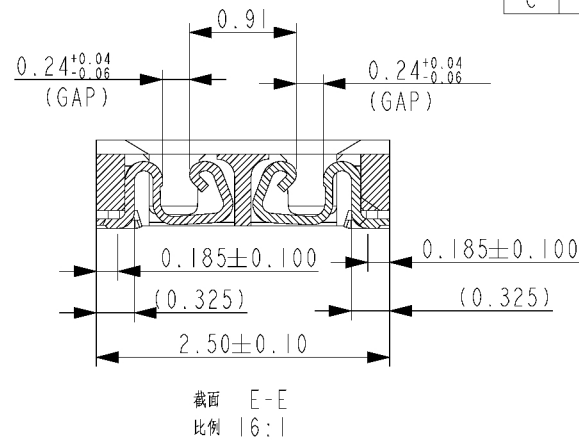


比例 10:1

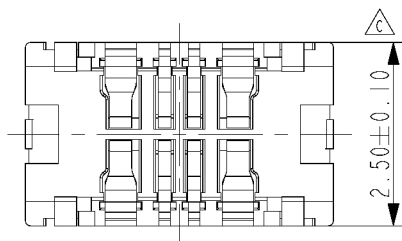


截面 E-E
比例 16:1

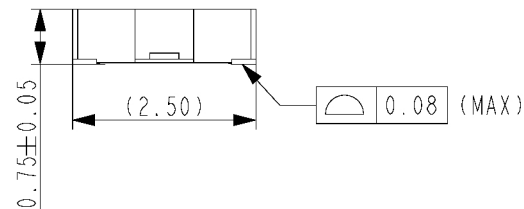


PLUG(MALE)

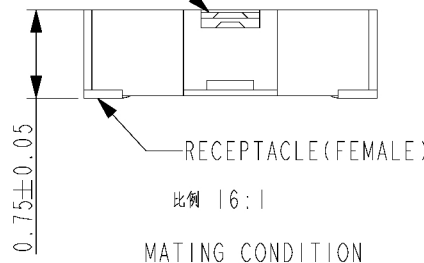

MATING CONDITION

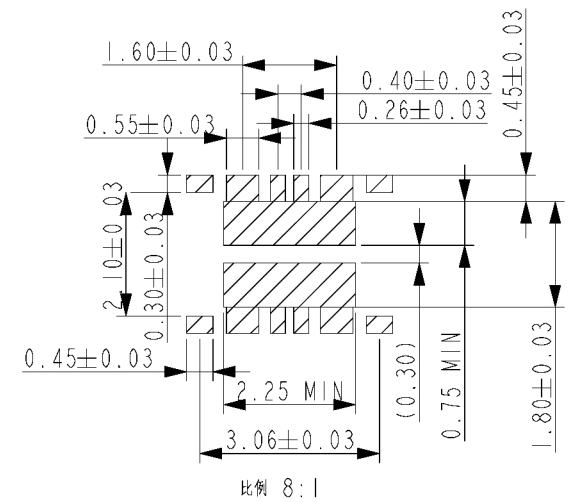

比例 8:1

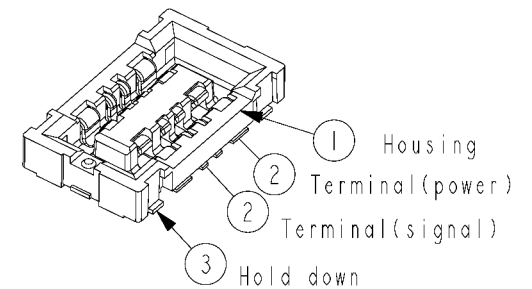

NOTE:

1. No rust,contamination,damage nor deformation effecting on function
2. Lead co-planarity: Max 0.08mm

3	HOLD DOWN	2	Phosphor Bronze	GOLD FLASH OVER NI
2	Contact terminal power&signal	8	Copper Alloy C7035	4u"GOLD PLATING ON CONTACT AREA, GOLD FLASH OVER NI ON SOLDER AREA
1	HOUSING	1	High Temperature Plastic	BLACK
ITEM	NAME	Q'TY	MATERIAL	REMARK/FINISH

GENERAL TOLERANCE	
X. ±0.40	
.X ±0.25	X.° ±3.0°
.XX ±0.15	.X° ±2.0°
.XXX ±0.10	.XX° ±1.0°

SCALE:	10:1
UNIT:	mm
SIZE:	A4


DRAWN	SEAN
CHECK	
APPROVE	

DATE	10/21/15'
DATE	
DATE	

DWG. NO.	600-3563-01
PARTS NO.(INTENDED USE)	818003563


TITLE	CUSTOMER DRAWING	REV.	C
	BTB CONN H0.75 8P RECEP	SHEET	1 / 1

REV.	ECN NUMBER	DESCRIPTION	DATE	DRAWN	CHECKD	APPROVED
A	PDR15323	NEW RELEASE	10/21/15'	SEAN	SEAN	SEAN
B	ECN161216	△X02 MX02	06/30/16'	ADDY		SEAN
C	ECN161915	△X01 MX01	02/20/17'	ADDY		SEAN

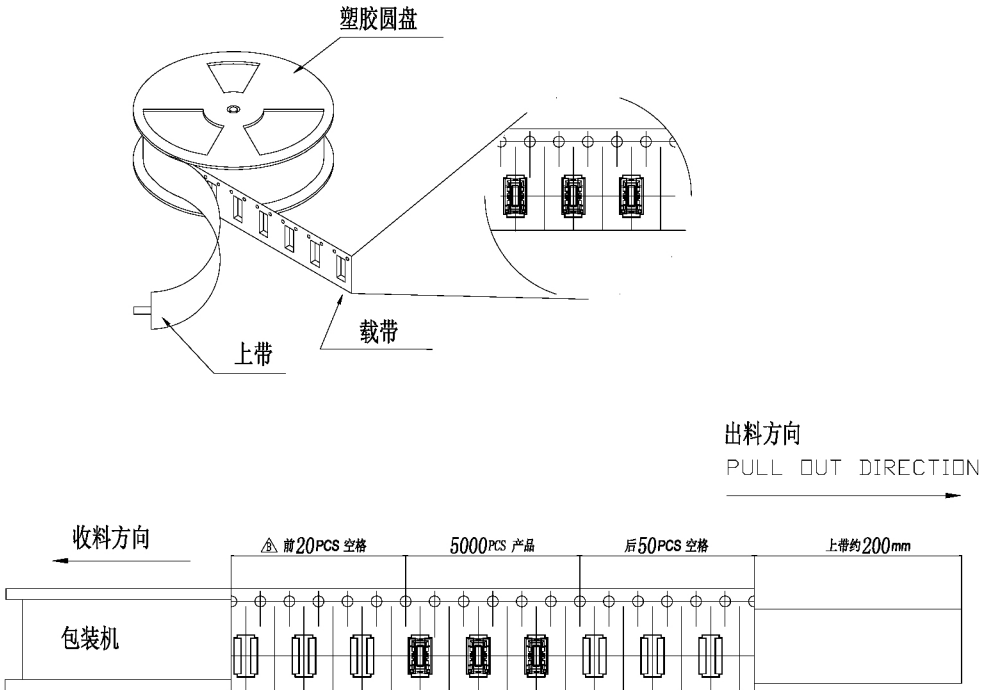

- 管制重点:
1. 包装时产品轻拿轻放, 避免产品变形.
 2. 整盘包装好后, 检查是否有漏装, 产品的放置方向是否正确.
 3. 包装载带断裂时不可用人工连接.
 4. 检查是否有产品被压死, 检查整擦层数是否正确.
 5. 若有未装满之零数箱, 须以缓冲材塞满.
 6. 防水袋封口须密封.
 7. 整箱封好后, 检查标签是否贴好, 干净, 字迹清晰, 标签内容是否正确, 完善.
 8. 外纸箱: 内尺寸L340*W340*H315mm

包 装 材 料			产 品 包 装 容 量		
项目	料 号	数量	Pcs/盘	盘/外箱	PCS/外箱
外纸箱	840000602	1	5000	14	70000
塑胶圆盘	840000404	14			
防水袋	840000501	1			
载带	843563XXX				
上带	840000838				
三角纸板		4			
作业标签		2			
珍珠绵		2			

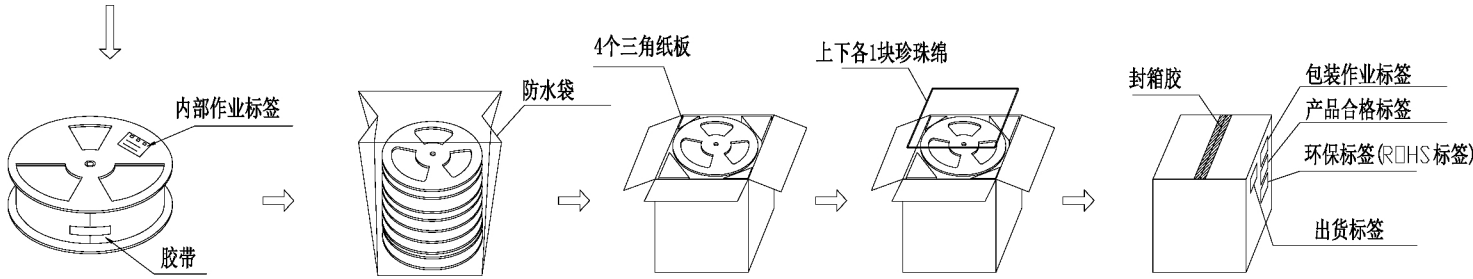

GENERAL TOLERANCE		SCALE:	DRAWN	DATE	DWG. NO.	TITLE	REV.
X. ±0.40		10:1	SEAN	10/21/15'	600-3563-01	CUSTOMER DRAWING	C
.X ±0.25	X.° ±3.0°	UNIT: mm	CHECK	DATE	PARTS NO. (INTENDED USE)		SHEET
.XX ±0.15	.X° ±2.0°	SIZE: A4	APPROVE	DATE	818003563	BTB CONN H0.75 8P RECP	2 / 2
.XXX ±0.10	.XX° ±1.0°						